




Series
TFP-GI

Gas Turbine Flow Meter

PPS Body, 0 to 5 VDC Output, LCD Indication



Flow Transmitters,
Turbine

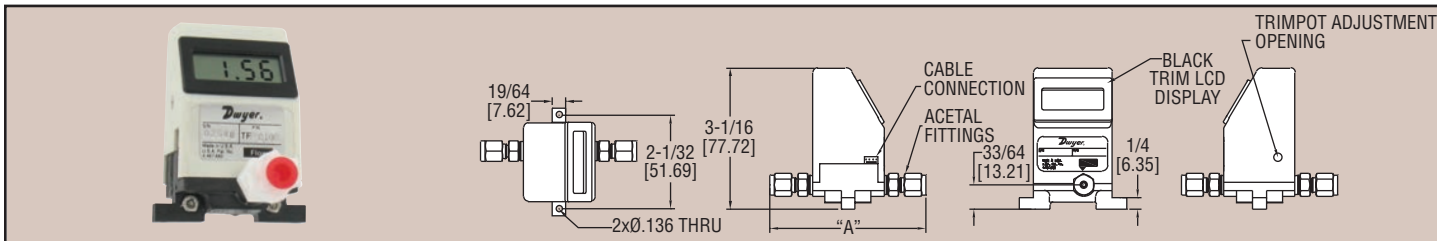

Series TFP-GI Gas Turbine Flow Meters are suitable for a wide variety of industrial, commercial, and laboratory flow applications. These meters utilize a turbine wheel and electro-optical detection to convert flow rates into a linear 0 to 5 VDC output signal for recording and data logging. A 3-1/2 digit LCD informs the user of the actual flow rate. A power adapter or mating cable assembly is required for operation.

Model	Range	Connection	"A" (in)
TFP-GI03	.042 to .21 SCFH (.02 to .1 LPM)	1/8" OD	3-27/64
TFP-GI04	.085 to .42 SCFH (.04 to .2 LPM)	1/8" OD	3-27/64
TFP-GI05	.21 to 1.1 SCFH (.1 to .5 LPM)	1/8" OD	3-27/64
TFP-GI06	.42 to 2.1 SCFH (.2 to 1 LPM)	1/8" OD	3-27/64
TFP-GI07	.85 to 4.2 SCFH (.4 to 2 LPM)	1/4" OD	3-13/16
TFP-GI08	2.1 to 11 SCFH (1 to 5 LPM)	1/4" OD	3-13/16

ACCESSORIES

Model	Description
A-454	115 VAC Power Adapter and Signal Cable
A-455	230 VAC Power Adapter and Signal Cable
A-456	36" Mating Cable with Spliced Leads

SPECIFICATIONS

Service: Clean dry gases compatible with wetted materials.

Wetted Materials: PPS, acetal, sapphire, glass, epoxy, and fluoroelastomer.

Accuracy: ±3% of full-scale.

Linearity: ±3% of full-scale.

Repeatability: ±0.5% of full-scale.

Temperature Limits: 41 to 131°F (5 to 55°C); Storage: 32 to 158°F (0 to 70°C);

Sensitivity: ±0.2% of full-scale per °C.

Pressure Limits: 40 psig (2.8 bar).

Process Connection: Compression fitting, see model table.

Power Requirements: 11.5 to 15 VDC.

Power Consumption: 35 mA @ 12 VDC.

Output Signal: 0 to 5 VDC: Minimum 2.5 kΩ load.

Electrical Connections: Four-pin power and signal connector. A power adapter or mating cable required for operation. See accessories table.

Display: LCD, 0.39" (10 mm) digits (only in LPM).

Enclosure Rating: IP10 (NEMA 1).

Weight: 0.23 lb (101 g).

Agency Approvals: CE.